

Thermomelt® HEAT-STIK Marker 109 °F (43 °C)

LA-CO Industries, Inc.

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations
according to Canadian Hazardous Products Regulations (HPR)
Date of issue: 03/10/2015
Version: 1.0

SECTION 1: Identification of the substance/mixture and of the company/undertaking

1.1. Product identifier

Product form : Mixture
Trade name : Thermomelt® HEAT-STIK Marker 109 °F (43 °C)

1.2. Relevant identified uses of the substance or mixture and uses advised against

Use of the substance/mixture : Temperature indicator

1.3. Details of the supplier of the safety data sheet

LA-CO Industries, Inc.
1201 Pratt Boulevard
Elk Grove Village, IL. 60007-5746
Phone: (847) 956-7600
Fax: (847) 956-9885
E-mail: customer_service@laco.com



1.4. Emergency telephone number

Emergency number : 24-hour emergency: CHEMTREC- U.S. : 1-800-424-9300 International: +1-703-527-3887

SECTION 2: Hazards identification

2.1. Classification of the substance or mixture

Classification in accordance with the Globally Harmonized Standard

Eye Dam. 1 H318
Full text of H-phrases: see section 16

2.2. Label elements

GHS-US labelling

Hazard pictograms (GHS-US) :



GHS05

Signal word (GHS-US) : Danger
Hazard statements (GHS-US) : H318 - Causes serious eye damage
Precautionary statements (GHS-US) : P280 - Wear eye protection, protective gloves
P305+P351+P338 - If in eyes: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing
P310 - Immediately call a doctor

2.3. Other hazards

No additional information available

SECTION 3: Composition/information on ingredients

3.1. Substance

Not applicable

3.2. Mixture

Name	Product identifier	% (w/w)	GHS-US classification
lauric acid	(CAS No) 143-07-7	83.33	Eye Dam. 1, H318

Full text of H-phrases: see section 16

Thermomelt® HEAT-STIK Marker 109 °F (43 °C)

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations
according to Canadian Hazardous Products Regulations (HPR)

SECTION 4: First aid measures

4.1. Description of first aid measures

- First-aid measures general : Never give anything by mouth to an unconscious person. If you feel unwell, seek medical advice (show the label where possible).
- First-aid measures after inhalation : Remove victim to fresh air and keep at rest in a position comfortable for breathing.
- First-aid measures after skin contact : Wash skin with mild soap and water. Wash contaminated clothing before reuse.
- First-aid measures after eye contact : IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. Immediately call a POISON CENTER or doctor/physician.
- First-aid measures after ingestion : Do NOT induce vomiting. Call a POISON CENTER or doctor/physician if you feel unwell.

4.2. Most important symptoms and effects, both acute and delayed

- Symptoms/injuries after eye contact : Causes serious eye damage.

4.3. Indication of any immediate medical attention and special treatment needed

All treatments should be based on observed signs and symptoms of distress in the patient.

SECTION 5: Firefighting measures

5.1. Extinguishing media

- Suitable extinguishing media : Carbon dioxide. Dry powder. Foam. Water spray. Sand.
- Unsuitable extinguishing media : Do not use a heavy water stream.

5.2. Special hazards arising from the substance or mixture

- Fire hazard : No specific fire or explosion hazard.
- Reactivity : No dangerous reactions known.

5.3. Advice for firefighters

- Firefighting instructions : Use water spray or fog for cooling exposed containers. Exercise caution when fighting any chemical fire. Do not allow run-off from fire fighting to enter drains or water courses.
- Protection during firefighting : Do not enter fire area without proper protective equipment, including respiratory protection. Wear fire/flame resistant/retardant clothing. Wear a self contained breathing apparatus..

SECTION 6: Accidental release measures

6.1. Personal precautions, protective equipment and emergency procedures

- General measures : Avoid creating or spreading dust. Avoid contact with skin and eyes.

6.1.1. For non-emergency personnel

- Protective equipment : Where excessive dust may result, use approved respiratory protection equipment. Wear suitable gloves. Chemical goggles or safety glasses.
- Emergency procedures : Evacuate unnecessary personnel.

6.1.2. For emergency responders

- Protective equipment : Where excessive dust may result, use approved respiratory protection equipment. Wear suitable gloves. Chemical goggles or safety glasses.
- Emergency procedures : Ventilate area.

6.2. Environmental precautions

Avoid release to the environment.

6.3. Methods and material for containment and cleaning up

- For containment : Contain and collect as any solid. Avoid generating dust.
- Methods for cleaning up : Take up in non-combustible absorbent material and shove into container for disposal. Minimize generation of dust.

6.4. Reference to other sections

Section 13: disposal information. Section 7: safe handling. Section 8: personal protective equipment.

SECTION 7: Handling and storage

7.1. Precautions for safe handling

- Precautions for safe handling : Avoid contact with skin and eyes.

Thermomelt® HEAT-STIK Marker 109 °F (43 °C)

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations
according to Canadian Hazardous Products Regulations (HPR)

Hygiene measures : Wash hands and other exposed areas with mild soap and water before eating, drinking or smoking and when leaving work.

7.2. Conditions for safe storage, including any incompatibilities

Storage conditions : Keep container closed when not in use. Store in a dry, cool and well-ventilated place.
Incompatible products : Strong acids. Strong oxidizers. Strong bases.

7.3. Specific end use(s)

Temperature indicator.

SECTION 8: Exposure controls/personal protection

8.1. Control parameters

Thermomelt® HEAT-STIK Marker 109 °F (43 °C)	
ACGIH	Not applicable
OSHA	Not applicable
lauric acid (143-07-7)	
ACGIH	Not applicable
OSHA	Not applicable

8.2. Exposure controls

Appropriate engineering controls : Avoid dispersal of dust in the air (ie, clearing dust surfaces with compressed air). Eyewash stations. Either local exhaust or general room ventilation is usually required.

Personal protective equipment : Avoid all unnecessary exposure.

Hand protection : It is a good industrial hygiene practice to minimize skin contact. If dust is formed: Use rubber gloves.

Eye protection : Chemical goggles or face shield. In case of dust production: protective goggles.

Respiratory protection : Where excessive dust may result, use approved respiratory protection equipment. Use air-purifying respirator equipped with particulate filtering cartridges.

Thermal hazard protection : Flame retardant clothing should be used when handling in molten state.

SECTION 9: Physical and chemical properties

9.1. Information on basic physical and chemical properties

Physical state : Solid

Appearance : A solid crayon-like marker.

Colour : light colored. Green.

Odour : odourless.

Odour threshold : No data available

pH : No data available

Relative evaporation rate (butyl acetate=1) : No data available

Melting point : 43 °C / 109 °F

Freezing point : No data available

Boiling point : No data available

Flash point : > 160 °C Closed cup

Auto-ignition temperature : No data available

Decomposition temperature : No data available

Flammability (solid, gas) : No data available

Vapour pressure : No data available

Relative vapour density at 20 °C : No data available

Relative density : > 1

Solubility : No data available

Log Pow : No data available

Log Kow : No data available

Viscosity, kinematic : No data available

Viscosity, dynamic : No data available

Explosive properties : No data available

Oxidising properties : No data available

Thermomelt® HEAT-STIK Marker 109 °F (43 °C)

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations
according to Canadian Hazardous Products Regulations (HPR)

Explosive limits : No data available

9.2. Other information

VOC content : 0 %

SECTION 10: Stability and reactivity

10.1. Reactivity

No dangerous reactions known.

10.2. Chemical stability

Stable at ambient temperature and under normal conditions of use.

10.3. Possibility of hazardous reactions

Hazardous polymerization will not occur.

10.4. Conditions to avoid

Avoid creating or spreading dust. Contact with incompatible materials.

10.5. Incompatible materials

Strong oxidizing agents. Strong bases. Strong acids.

10.6. Hazardous decomposition products

Burning produces irritating, toxic and noxious fumes.

SECTION 11: Toxicological information

11.1. Information on toxicological effects

Acute toxicity : Not classified

lauric acid (143-07-7)	
LD50 oral rat	> 5000 mg/kg
LD50 dermal rabbit	> 2000 mg/kg read-across stearic acid
LC50 inhalation rat (mg/l)	> 0.1621 mg/l/4h read-across octanoic acid

Skin corrosion/irritation : Not classified

Serious eye damage/irritation : Causes serious eye damage.

Respiratory or skin sensitisation : Not classified

Germ cell mutagenicity : Not classified

Carcinogenicity : Not classified

Reproductive toxicity : Not classified

Specific target organ toxicity (single exposure) : Not classified

Specific target organ toxicity (repeated exposure) : Not classified

Aspiration hazard : Not classified

Potential adverse human health effects and symptoms

Symptoms/injuries after eye contact : Causes serious eye damage.

Likely routes of exposure : Skin and eye contact;Inhalation

SECTION 12: Ecological information

12.1. Toxicity

lauric acid (143-07-7)	
LC50 fish 1	5 mg/l 96 h
EC50 Daphnia 1	3.6 mg/l 48 hc

12.2. Persistence and degradability

lauric acid (143-07-7)	
Persistence and degradability	Readily biodegradable.
Biodegradation	85 % 30 d

12.3. Bioaccumulative potential

lauric acid (143-07-7)	
Log Pow	0.05

Thermomelt® HEAT-STIK Marker 109 °F (43 °C)

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations
according to Canadian Hazardous Products Regulations (HPR)

12.4. Mobility in soil

No additional information available

12.5. Other adverse effects

No additional information available

SECTION 13: Disposal considerations

13.1 Waste treatment methods

Sewage disposal recommendations : Do not dispose of waste into sewer.
Waste disposal recommendations : Dispose in a safe manner in accordance with local/national regulations.
Ecology - waste materials : Avoid release to the environment.

SECTION 14: Transport information

In accordance with DOT and TDG
Not considered a dangerous good for transport regulations
Proper Shipping Name (ADR) : Not applicable

Transport by sea

No additional information available

Air transport

No additional information available

SECTION 15: Regulatory information

15.1. US Federal regulations

lauric acid (143-07-7)

Listed on the United States TSCA (Toxic Substances Control Act) inventory

15.2. International regulations

CANADA

lauric acid (143-07-7)

Listed on the Canadian DSL (Domestic Substances List) inventory.

EU-Regulations

lauric acid (143-07-7)

Listed on the EEC inventory EINECS (European Inventory of Existing Commercial Chemical Substances)

National regulations

Thermomelt® HEAT-STIK Marker 109 °F (43 °C)

All components are listed on the EEC inventory European Inventory of Existing Commercial Chemical Substances (EINECS).
All ingredients are listed on the Canadian Domestic Substances List (DSL) or Non-Domestic Substances List (NDSL).
All ingredients are listed in the Toxic Substances Control Act (TSCA).

15.3. US State regulations

No additional information available

SECTION 16: Other information


Indication of changes : Original Document.

Thermomelt® HEAT-STIK Marker 109 °F (43 °C)

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations
according to Canadian Hazardous Products Regulations (HPR)

Data sources	: ACGIH 2000. Canadian Centre for Occupational Health and Safety. Accessed at: http://www.ccohs.ca/oshanswers/legisl/whmis_classifi.html . ESIS (European chemical Substances Information System; accessed at: http://esis.jrc.ec.europa.eu/index.php?PGM=cla . European Chemicals Agency (ECHA) Registered Substances list. Accessed at http://echa.europa.eu/ . Krister Forsberg and S.Z. Mansdorf, "Quick Selection Guide to Chemical Protective Clothing", Fifth Edition. National Fire Protection Association; Fire Protection Guide to Hazardous Materials; 10th edition. OSHA 29CFR 1910.1200 Hazard Communication Standard. REGULATION (EC) No 1272/2008 OF THE EUROPEAN PARLIAMENT AND OF THE COUNCIL of 16 December 2008 on classification, labelling and packaging of substances and mixtures, amending and repealing Directives 67/548/EEC and 1999/45/EC, and amending Regulation (EC) No 1907/2006. TSCA Chemical Substance Inventory. Accessed at http://www.epa.gov/oppt/existingchemicals/pubs/tscainventory/howto.html .
Abbreviations and acronyms	: ACGIH (American Conference of Government Industrial Hygienists). ATE: Acute Toxicity Estimate. CAS (Chemical Abstracts Service) number. CLP: Classification, Labelling, Packaging. EC50: Environmental Concentration associated with a response by 50% of the test population. GHS: Globally Harmonized System (of Classification and Labeling of Chemicals). LD50: Lethal Dose for 50% of the test population. OSHA: Occupational Safety & Health Administration. PBT: Persistent, Bioaccumulative, Toxic. STEL: Short Term Exposure Limits. TSCA: Toxic Substances Control Act. TWA: Time Weight Average.
Other information	: None.
NFPA health hazard	: 2 - Intense or continued exposure could cause temporary incapacitation or possible residual injury unless prompt medical attention is given.
NFPA fire hazard	: 1 - Must be preheated before ignition can occur.
NFPA reactivity	: 0 - Normally stable, even under fire exposure conditions, and not reactive with water.

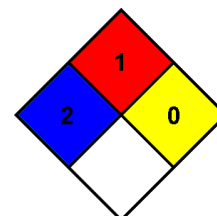

Full text of H-phrases:

Eye Dam. 1	Serious eye damage/eye irritation, Category 1
H318	Causes serious eye damage

SDS Prepared by: The Redstone Group, LLC
6397 Emerald Pkwy.
Suite 200
Dublin, OH USA 43016
T 614-923-7472
www.redstonegrp.com

LACO NA GHS SDS

This information is based on our current knowledge and is intended to describe the product for the purposes of health, safety and environmental requirements only. It should not therefore be construed as guaranteeing any specific property of the product